

FOR RECYCLING PURPOSES ONLY

Disassembly Instructions

Switch Fuses OS200...250

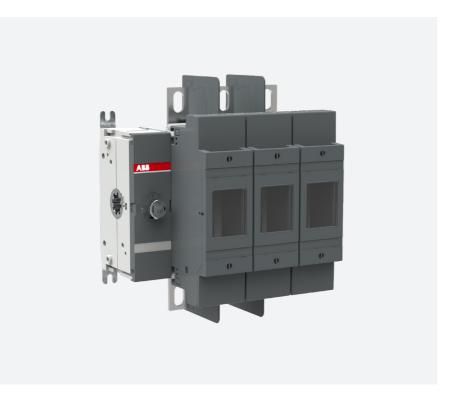


Table of contents

003	Important information	
004 -006	Disassembly of the switch fuse	
007 –008	Disassembly of the pole	
009 -014	Disassembly of the mechanism	
015 -017	Component list	
018	Recycling information in accordance with the WEEE	

Important information

This document shows the disassembly process of OS200...250 switch fuses. Accessories, such as shafts, shrouds, additional poles and auxiliary contacts are not included. Note! This document is for recycling purposes only.

This document uses OS200J03 version as a reference product, and it covers other versions of OS200...250 switch fuses with few differences to be taken into account. These differences include number of poles, pole configuration, side or front operation. Other differences between switch fuses may result from accessories, including shafts, handles, phase barriers, shrouds, connection bars, auxiliary contacts, mechanical lugs and interlocks.

Safety Notes

Before starting the disassembly process it is mandatory to put the switch fuse in open position.

Disassembly of switch fuses must be performed by qualified and skilled personnel in the electrical field (IEV 195-04-01: person with relevant education and experience to enable him or her to perceive risks and to avoid hazards which electricity can create) and having a detailed knowledge of switch fuses.

Disassembly must be done in an ergonomic workspace which can ensure the protection of the person doing the disassembling.

Applicable national legislation and international standards in force at the time of the disassembly of the switch fuses must be taken into account in addition to the prescriptions illustrated in this document. ABB declines any responsibility for injury to people or damage to property resulting from a failure to comply with the instructions set out in this document and with any applicable safety standard.

Personal Protective Equipment (PPE)

When doing the disassembling following safety Personal Protective Equipment (PPE) must be worn:

Glasses Gloves Safety Protective shoes clothes









Tools

The disassembly process requires the use of tools (e.g. screwdriver, torx key, pliers). Tools to be used are specified inside each phase of the disassembly process.


Disassembly process


For each phase of the disassembly process the following information is provided:

- Tools to be used
- · Pictures showing actions to be performed
- In case of potential hazards signal below is reported:



Disassembly of the switch fuse

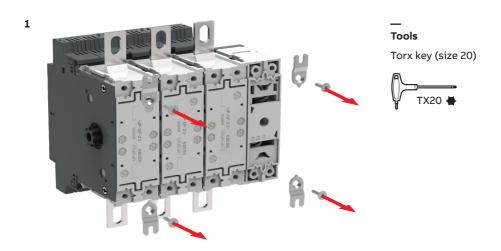

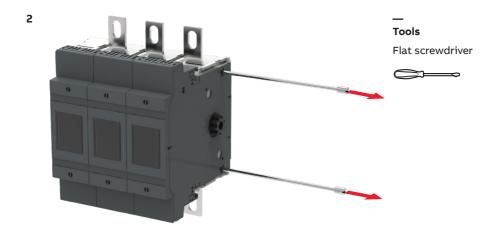






Tools

Flat screwdriver





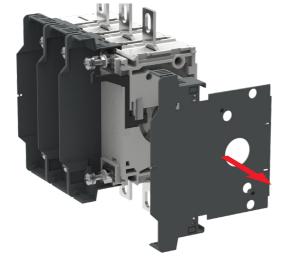








Disassembly of the pole

Tools
Screwdriver (PH2)

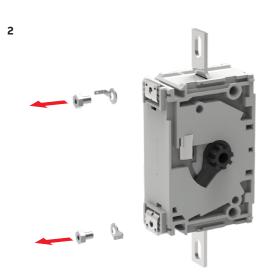


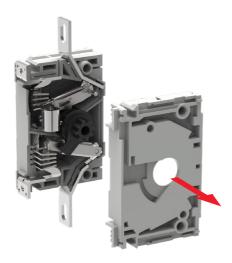
 



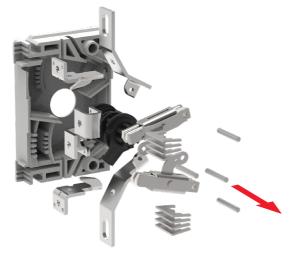

Disassembly of the mechanism

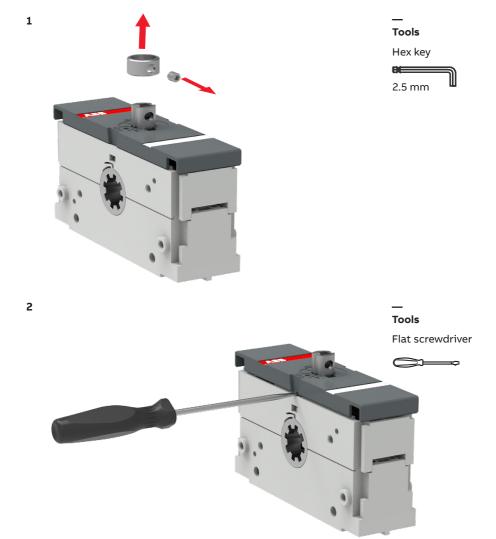

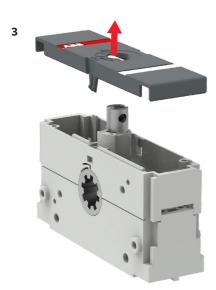



Tools

Flat screwdriver







6




Tools

Torx key (size 8)





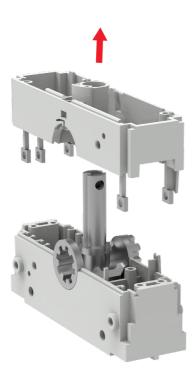











Component list

Switch fuse OS200J03*

Component name	Quantity	Material(s)	Weight (g/pc)
Pole module	3		671.4
Locking plug	3	Polyarylamide	4.4
Compression spring	3	Steel	0.09
Phase barrier UL	2	Polyarylamide	56
End plate UL	2	Polyarylamide	44
Mechanism	1		179
Hexagon socket head screw	1	Steel	0.5
Locking ring	1	Steel	5.4
Stud screw	2	Steel	13.5
Mounting plate	4	Steel	5
Screw	4	Steel	1.6
Cover + window	3		33.5
Cover UL	1	Polycarbonate	31
Window	1	Polycarbonate	2.6
Phase barrier	4	Polycarbonate	8.1
Mounting set	1		192.5
Steel hex screw	6	Steel	13.8
Stainless spring washer	6	Steel	1.6
Washer (plated steel)	12	Steel	5.2
Steel hex nut	6	Steel	5.7
Polyethylene plastic film	1	Polyethylene	3
Plate	1	Printed paper	0.9

^{*}This table concerns the switch fuse OS200J03. Components, quantities, weights and materials may vary depending on the product.

Pole module

Component name	Quantity	Material(s) Weight (g/pc)
Pole	1		601.2
Frame A	1	Polyest-resi	n 146.3
Frame B	1	Polyest-resi	n 148.8
Roll	1	Polyarylamid	e 36
Contact construction	1		57.2
Contact knife	2	Coppe	r 13.3
Contact iron	2	Stee	12.4
Contact spring	1	Stee	1.9
Plug	1	Stee	1.9
Interm. rod	1	Stee	el 3.7
Contact construction	1		57.2
Contact knife	2	Coppe	r 13.3
Contact iron	2	Stee	12.4
Contact spring	1	Stee	1.9
Plug	4	Stee	2.6
Interm. rod	1	Polyamid	e 1.3
Arc plate	8	Stee	2.6
Fixed contact	2	Coppe	r 25
Connection bar	1	Coppe	r 40.7
Connection bar	1	Coppe	r 40.7
Plug	4	Stee	2.6
Locking piece	1	Polyamid	e 1.3
Spring washer	2	Stee	0.9
Screw	2	Stee	4.1
Fuse clip	2	Coppe	r 22.7
Screw	2	Stee	el 7.4

Mechanism

Quantity	Material(s)	Weight (g/pc)
1		53.1
1	Polyamide	3
1	Polyamide	47.6
1	Polyamide	2.6
1		125.6
1	Zinc alloy	37
1	Zinc alloy	22
1	Zinc alloy	39
2	Steel	9.7
1	Steel	2.6
8	Steel	0.6
2	Steel	0.8
	1 1 1 1 1 1 1 1 2 1 8	1 1 Polyamide 1 Polyamide 1 Polyamide 1 Polyamide 1 Zinc alloy 1 Zinc alloy 2 Steel 1 Steel 8 Steel

Recycling information in accordance with the WEEE

The product is marked with the wheelie bin symbol. It indicates that at the end of life the product should enter the recycling system.

You should dispose of it separately at an appropriate collection point and not place it in the normal waste stream.

The figure below shows the wheelie bin symbol indicating separate collection for electrical and electronic equipment (EEE).



The horizontal bar underneath the crossed-out wheelie bin indicates that the equipment has been manufactured after the Directive came into force in 2005.

The wheelie bin symbol is added to the type designation label of the product since 2017.



Contact us

ABB Oy

P.O. Box 622 FI-65101 Vaasa Finland

abb.com/lowvoltage