


SpaceLogic™ Room Controllers

SE8000 Compatibility Matrix

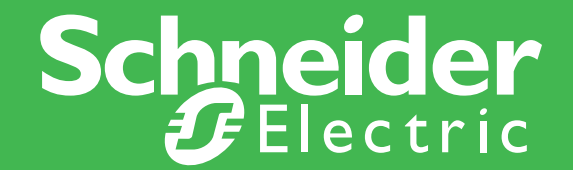

		Schneider Electric SEx83, SE86 & SEZ82 ④															
		SE8000	1.4		1.5 & 1.6		1.7		2.0	2.1	2.2	2.3 ④	2.4	2.4.1	2.5	2.5.1	2.6
Plug-in Modules	VCM8002 (Wi-Fi)										1.0	1.0	1.1	1.2	1.3	1.4	1.4
	VCM8000 (Zigbee Pro) ③ ⑥	6	9	10	9	10	10	20	20	22	23	24	30	30	31	31	32 ⑨
	VCM8001 (CO2)				✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Zigbee Pro Wireless Sensors	Window/Door	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Motion	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Temperature							✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Humidity							✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	CO2							✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Water Leak							✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
SEC-TE	Rev 16 or later				✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦	✓⑦
MPM	Rev 2.18	✓①	✓①		✓①	✓①	✓①										
	Rev 2.19	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①
	Rev 2.20	✓	✓	✓	✓	✓	✓	✓	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①
	Rev 2.21	✓	✓	✓	✓	✓	✓	✓	✓	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①
	Rev 2.22	✓	✓	✓	✓	✓	✓	✓	✓	✓①	✓①	✓①	✓①	✓①	✓①	✓①	✓①
Zigbee Pro Wireless USB Adapter ⑧													✓	✓	✓	✓	
HRC	Rev 1.4 or later						✓②	✓②	✓②	✓②	✓②	✓②	✓②	✓②	✓②	✓②	✓②
Facility Expert													✓⑤	✓⑤	✓⑤	✓⑤	✓⑤
Uploader 8000	Rev 1.0	✓	✓	✓	✓	✓	✓	✓									
	Rev 2.0	✓	✓	✓	✓	✓	✓	✓									
	Rev 3.x						✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Uploader Config. of Wi-Fi															✓	✓	

Description	Part List
Wi-Fi Communication Module	VCM8002V5031
Zigbee Pro Communication Module	VCM8000V5045P
CO2 Sensor Module	VCM8001V5045
Window/Door Sensor	SED-WDC-G-5045
Motion Sensor	SED-WMS-P-5045 and/or SED-MTH-G-5045
Temperature Sensor	SED-CO2-G-5045 and/or SED-MTH-G-5045 and/or SED-TRH-G-5045
Humidity Sensor	SED-CO2-G-5045 and/or SED-MTH-G-5045 and/or SED-TRH-G-5045
CO2 Sensor	SED-CO2-G-5045
Water Leak Sensor	SED-WLS-G-5045
Smart Terminal Controller	SEC-TEA-24-5045 SEC-TEA-230-5045 SEC-TEA-R-24-5045 SEC-TEA-R-230-5045 And more... Refer to SCE-TE documentation for more information.
Multi-Purpose Manager	MPM-GW-010-5045 MPM-UN-004-5045 MPM-UN-014-5045 MPM-VA-004-5045 MPM-VA-014-5045 And more... Refer to MPM documentation for more information.
Wireless Adapter - Advanced	SXWZBAUSB10001
Hotel Room Controller	HRCPDG42R HRCPBG28R

- ✓ = Full objects supported.
- ① = Partial objects supported (missing new objects).
- ② = HRC does not support CO2 and water leak sensors, and is not compatible with SE8650.
- ③ = Using older VCMs in the range 10-24 with SE8000 Room Controllers up to version 2.3 is not recommended, however will function with reduced features. From SE8000 version 2.4, VCM 30 or newer must be used.
- ④ = The SEZ8250 requires VCM8000 (Zigbee Pro) revision 24 and later.
- ⑤ = Facility Expert is compatible with SE8650 RTU, SE8350 and SER8350.
- ⑥ = The hardware revision number is found underneath the VCM module. The firmware (starting at version 20) on 051-0131R11 and later is upgradable and downgradable. The firmware on 051-0131R10 and earlier cannot be upgraded.
- ⑦ = SEC-TE is compatible with SER8350 only.
- ⑧ = The Wireless Adapter - Advanced enables Zigbee 3.0 wireless connectivity for AS-P/AS-B Automation Servers and RP-C/RP-V Room Purpose Controllers.
- ⑨ = Zigbee network high security level support starts at SE8000 firmware revision 2.6 and Zigbee firmware revision 32.
- (empty) = Not supported.

NOTICE

UPGRADE OF ZIGBEE FIRMWARE REVISION 24 TO 30

The upgrade from Zigbee firmware revision 24 to 30 will **not** support the Green Power Sensor (SED-CO2-G-5045 or SED-TRH-G-5045). It will therefore need to be recommissioned.

There is also a new "Security Levels" parameter for the Zigbee network:

- **Low** (default value) is fully backwards compatible with Zigbee Home Automation 1.2 devices, and therefore compatible with all of our sensors.
- **Normal** or **High** (needs to be selected by user) is only compatible with Green Power and Zigbee 3.0 network standard (Leedarson sensors). If the Normal or High Security Level is selected with old NYCE or Centralite sensors, they will be removed from the network.

Failure to follow these instructions can result in equipment being disconnected from the network.

NOTICE

TOUCHSCREEN ISSUES

A new Printed Circuit Board Assembly (PCBA) is used in the latest version of the Room Controller hardware:

- **Firmware 2.6 and newer:** Works with both the old and new hardware.
- **Firmware 2.5 and older:** Does not work with the new hardware, making the touchscreen inoperative.

Do not downgrade the firmware on the new hardware. If you have issues with your Room Controller touchscreen, upgrade your device to Firmware 2.6 or newer.

Failure to follow these instructions can result in equipment malfunction.